


Ram Truck 1500 4WD Differential Housing Repair / Front Right, 2012-Up – Intermediate Shaft - Repair Kit CH-3511RK

OE Problem

Clunking (or) vibration noises when trying to apply 4WD. The dashboard light indicates the Shift Actuator is working but it will not engage in 4WD.

Issue:

The front right differential Intermediate Shaft to CV inboard joint splines are stripped which also causes a bearing failure.

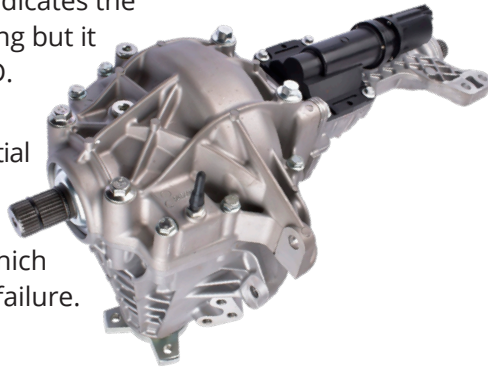

TrakMotive Solution

TrakMotive Kit CH-3511RK (Rebuild Kit) includes all necessary parts, including a new intermediate shaft with all the components required to complete the repair, without having to spend thousands of dollars for a new differential.



Needle Bearing Included



Customer Alert / Recommendation:

The original connecting CV Shaft could also be defective if the intermediate shaft is damaged and should be replaced.

We strongly recommend replacing the CV Shaft with a new TrakMotive CH-8256, CH-8256HDX or CH-8256XTT when completing the job.



CH-8256 OE Replacement CV Axle



CH-8256HDX



CH-8256XTT

Note: If “upgrading” to the CH-8256HDX (or) CH-8256XTT, the CV Axles should be installed in pairs (left & right) to ensure proper performance.

Do the Job Right the First Time, Save Money, Aggravation, and Additional Repairs Down the Road!